

# Team Update 18


## GENERAL

### Official Drawings

GE-23128 and GE-23129 (and their parent drawings and folders, including the [game specific drawing package](#) and [CAD model](#)) are updated to reflect additional material added to reinforce the Double Substation structure.

### Control System Message

We are tracking an issue being reported where previously working Robot Code does not load as expected on roboRIO boot, as shown by the “No Robot Code” indication in the image below persisting for longer than usual, and no messages related to robot code starting to appear in the console, shown by pressing the Gear icon then the +Prints button shown below. In these cases, the code generally does load properly after the roboRIO is rebooted using either the Reset button or the “Reboot roboRIO” button in the Diagnostics tab of the Driver Station software. We are still in the process of trying to reproduce this issue and identify the root-cause. FIRST Technical Advisors (FTAs) and Control System Advisors (CSAs) were advised to be aware of this issue and work with teams to reboot their roboRIO prior to a match if encountering this issue.

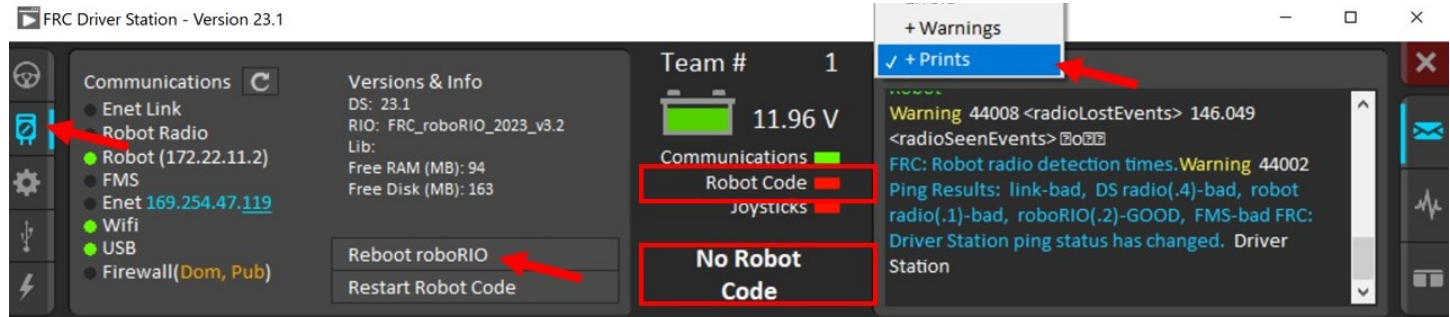

## GAME MANUAL

### Section 5 ARENA

Figures 5-3, -17, -19, -20, -21, and -33 are updated to reflect the modification described in “Official Drawings” above.